

ENGINEERS • PLANNERS • SCIENTISTS • CONSTRUCTION MANAGERS

936 RIDGEBROOK ROAD • SPARKS, MD 21152 • 410-316-7800 • (FAX) 410-316-7935

May 2, 2023

Mr. Brian Croyle, Environmental Specialist Montgomery County Public Schools Division of Sustainability and Compliance 8301 Turkey Thicket Drive Gaithersburg, MD 20879

Ref: <u>Sampling for Asphalt Fumes and Hydrogen Sulfide Gas – 04/20/2023</u> Poolesville High School KCI Job No. 122302497

KCI Technologies Inc. (KCI) is submitting the following letter report detailing the findings of air sampling of Asphalt Fumes (benzene soluble fraction) and Hydrogen Sulfide gas at Poolesville High School located at 17501 W. Willard Rd. Poolesville, MD 20837 (subject site). Sampling was conducted by KCI's Industrial Hygienist, Ms. Brittany Maas, under the oversight of KCI's Certified Industrial Hygienist (CIH), Mr. Jonathan Coale.

Background:

At Poolesville High School, current renovations and construction has raised concerns from student parents. Students and faculty have voiced concerns related to an odor present in the school while the roofing work is occurring. The parents are concerned the students are being exposed to unsafe conditions related to the asphalt fumes being produced during the roofing installation. MCPS contacted KCI to assist them in collecting data on the school's occupants' potential exposure to fumes related to the roofing work being conducted.

Description of the Work Performed:

On April 20, 2023, KCI conducted air sampling for Asphalt Fumes (benzene soluble fraction) and Hydrogen Sulfide gas levels at Poolesville High School. The sampling of Asphalt Fumes (benzene soluble fraction) was done under method: Modified NIOSH 5042. This method will determine the total concentration of total particulate and the soluble fraction to which an individual is exposed. NIOSH has an adopted value of 5 mg/m³ Threshold Limit Value (TLV) -Time-Weighted Average (TWA) for asphalt fumes. NIOSH's definition of TLV-TWA is the "concentration for a conventional 8-hour workday and a 40-hour workweek, to which it is believed that nearly all workers may be repeatedly exposed, day after day, for a working lifetime without adverse effect". KCI also utilized a mulit-gas meter to collect real time readings of hydrogen sulfide (H₂S), carbon monoxide (CO), and oxygen (O₂) levels in various locations throughout the building and exterior. Direct read data was performed to collect short term "grab" samples to determine if the gas was present and was not intended to collect exposure data.

During the time of the air sampling, construction was being conducted, asphalt smell was noted outside of the building. KCI placed six (6) sampling pumps set to approximately 1 liter per minute in locations predetermined by MCPS. It is KCI's understanding that the sample locations selected by MCPS were where complaints were made from students. After all sampling pumps were placed, KCI took real time readings of the hydrogen sulfide levels at each of these locations every 30 minutes inside and every 30 minutes outside. A sampling location map can be found in attachment A.

KCI conducted area sampling from approximately 0800 until 1430. Conditions during the sampling period were clear skies and 56°- 86°F. Winds were between 0 and 7 mph from N to NNE.

After sampling, the cassettes were sealed, logged, bagged, and shipped as required to Galson Laboratories in East Syracuse, NY, where they were analyzed for Asphalt Fume (benzene soluble fraction) Modified NIOSH Method 5042. Galson Laboratories is accredited by the American Industrial Hygiene Association (#100324).

Results:

Table 1 – Asphalt Fumes Sampling Summary						
Location	Sample Number	Concentration (mg/m ³)	Above TLV-TWA?			
Media Center Hallway – Outside Room 37	PH-01B	<0.28	No			
Arts Hallway – Outside Room 44	PH - 02B	<0.28	No			
Auditorium Lobby	PH - 03B	<0.28	No			
Science Building 1 st Floor – Outside Room 184	$\mathrm{PH}-\mathrm{04B}$	<0.28	No			
Science Building 2 nd Floor – Outside Room 284	PH - 05B	<0.28	No			
West End of Portables – (exterior)	PH - 06B	<0.28	No			
Field Blank	PH - 07B	N/A	N/A			
Lab Blank	PH - 08B	N/A	N/A			
N/A: Not Applicable						

Asphalt Fumes (Benzene Soluble Fraction)

Laboratory analysis results are included as Attachment B.

Gas Meter Readings

	Table 2 – Multi-Gas Meter Sampling Summary								
Time	Oxygen (O ₂)	Carbon Monoxide (CO)	Hydrogen Sulfide (H ₂ S)						
0800 - 0820	20.8	0	0						
0830 - 0835	20.8	0	0						
0900 - 0905	20.8	0	0						
0930 - 0935	20.8	0	0						
1000 - 1005	20.8	0	0						
1030 - 1035	20.8	0	0						
1100 - 1105	20.8	0	0						
1130 - 1135	20.8	0	0						
1200 - 1205	20.8	0	0						
1230 - 1235	20.8	0	0						
1300 - 1305	20.8	0	0						
1330 - 1335	20.8	0	0						
1400 - 1420	20.8	0	0						

Olfactory Findings

During walkthroughs, KCI noted the following asphalt smells:

Table 3 – Olfactory Investigation Summary				
Location	Findings			
Exterior Outside New Main Office	No Asphalt Smell			
Exterior Between Main Building & Science/Tech Addition	Moderate Asphalt Smell			
Exterior By Portables	Light Asphalt Smell			
Main Lobby	No Asphalt Smell			
Art Hallway	No Asphalt Smell			
Auditorium Corridor	No Asphalt Smell			
Gym Hallway	No Asphalt Smell			
Science and Technology Addition	Light Asphalt Smell			
Student Parking Lot	Heavy Asphalt Smell			

Conclusion:

In conclusion, the baseline sampling data determined airborne Asphalt Fumes concentrations were below the NIOSH TLV-TWA adopted value during the period of sampling. In addition, H_2S and CO concentrations were not present or at concentrations below the gas meters detectable range. Oxygen levels were at the expected levels.

During sampling, asphalt roofing activities were being performed.

If you have questions or comments regarding this report, please contact me.

Sincerely, KCI Technologies, Inc


Jonathan S. Coale, CIH, CIEC Certified Industrial Hygienist KCI Technologies, Inc.

Attachment A: Sample Locations Attachment B: Laboratory Certificate of Analysis Report for Air Samples

M:\2023\122302497\REPORTS\4.20.23 REPORT\LETTER REPORT-4.20.23 AIR SAMPLING_POOLESVILLE HS.DOC

Attachment A Field Notes



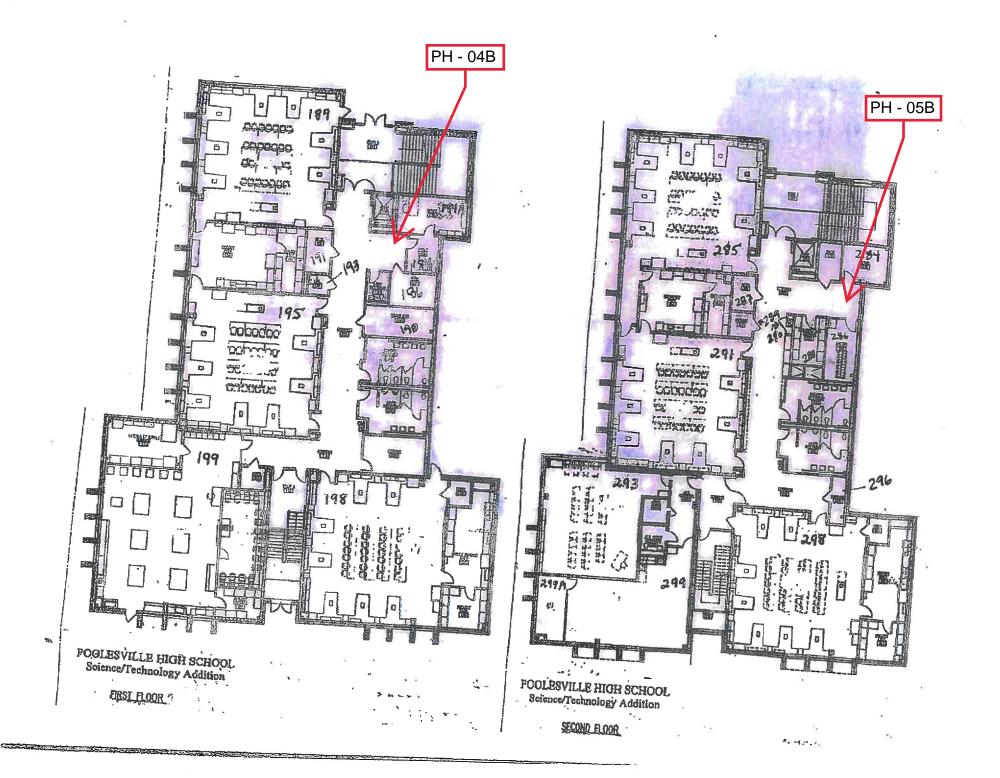

Attachment B Laboratory Certificate of Analysis Report for Air Samples



Jon Coale KCI Technologies 936 Ridgebrook Road Sparks Glencoe, MD 21152 April 28, 2023

Account# 17844

Login# L592039

Dear Jon Coale:

Enclosed are the analytical results for the samples received by our laboratory on April 21, 2023. All samples on the chain of custody were received in good condition unless otherwise noted. Any additional observations will be noted on the chain of custody.

Please contact client services at (888) 432-5227 if you would like any additional information regarding this report. Thank you for using SGS Galson.

Sincerely,

SGS Galson

Lisa-Luab

Lisa Swab Laboratory Director

Enclosure(s)



ANALYTICAL REPORT

Terms and Conditions & General Disclaimers

- This document is issued by the Company under its General Conditions of Service accessible at http://www.sgs.com/en/Terms-and-conditions.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein.
- Any holder of this document is advised that information contained herein reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law.

Analytical Disclaimers

- Unless otherwise noted within the report, all quality control results associated with the samples were within established control limits or did not impact reported results.
- Note: The findings recorded within this report were drawn from analysis of the sample(s) provided to the laboratory by the Client (or a third party acting at the Client's direction). The laboratory does not have control over the sampling process, including but not limited to the use of field equipment and collection media, as well as the sampling duration, collection volume or any other collection parameter used by the Client. The findings herein constitute no warranty of the sample's representativeness of any sampled environment, and strictly relate to the samples as they were presented to the laboratory. For recommended sampling collection parameters, please refer to the Sampling and Analysis Guide at www.sgsgalson.com.
- Unrounded results are carried through the calculations that yield the final result and the final result is rounded to the number of significant figures appropriate to the accuracy of the analytical method. Please note that results appearing in the columns preceding the final result column may have been rounded and therefore, if carried through the calculations, may not yield an identical final result to the one reported.
- The stated LOQs for each analyte represent the demonstrated LOQ concentrations prior to correction for desorption efficiency (if applicable).
- Unless otherwise noted within the report, results have not been blank corrected for any field blank or method blank data.

Accreditations SGS Galson holds a variety of accreditations and recognitions. Our quality management system conforms with the requirements of ISO/IEC 17025. Where applicable, samples may also be analyzed in accordance with the requirements of ELAP, NELAC, or LELAP under one of the state accrediting bodies listed below. Current Scopes of Accreditation can be viewed at http://www.sgsgalson.com in the accreditations section of the "About" page. To determine if the analyte tested falls under our scope of accreditation, please visit our website or call Client Services at (888) 432-5227.

National/International	Accreditation/Recognition	Lab ID#	Program/Sector
AIHA-LAP, LLC - IHLAP, ELLAP, EMLAP	ISO/IEC 17025 and USEPA NLLAP	Lab ID 100324	Industrial Hygiene, Environmental Lead,
			Environmental Microbiology

State	Accreditation/Recognition	Lab ID#	Program/Sector
New York (NYSDOH)	ELAP and NELAC (TNI)	Lab ID: 11626	Air Analysis, Solid and Hazardous Waste
Louisiana (LDEQ)	LELAP	Lab ID: 04083	Air Analysis, Solid Chemical Materials

Legend

< - Less than	mg - Milligrams	MDL - Method Detection Limit	ppb - Parts per Billion
> - Greater than	ug - Micrograms	NA - Not Applicable	ppm - Parts per Millior
l - Liters	m3 - Cubic Meters	NS - Not Specified	ppbv - ppb Volume
LOQ - Limit of Quantitation	kg - Kilograms	ND - Not Detected	ppmv - ppm Volume
ft2 - Square Feet	cm2 - Square Centimeters	in2 - Square Inches	ng - Nanograms



LABORATORY ANALYSIS REPORT

6601 Kirkville Road East Syracuse, NY 13057 (315) 432-5227 FAX: (315) 437-0571 www.sgsgalson.com

Client	:	KCI Technologies
Site	:	POOLESVILLE HS
Project No.	:	POOLESVILLE HS
Date Sampled	:	20-APR-23
Date Received	:	21-APR-23

Account No.: 17844 Login No. : L592039

Date Analyzed : 27-APR-23 Report ID : 1355139

Asphalt Fumes (Benzene-Soluble Fraction)

Sample ID	Lab ID	Air Vol liter	Total mg	Conc mg/m3
PH-01B	L592039-1	360	<0.10	<0.28
PH-02B	L592039-2	360	<0.10	<0.28
PH-03B	L592039-3	360	<0.10	<0.28
PH-04B	L592039-4	360	<0.10	<0.28
PH-05B	L592039-5	360	<0.10	<0.28
РН-06В	L592039-6	360	<0.10	<0.28
PH-07B	L592039-7	360	<0.10	<0.28
PH-08B	L592039-8	360	<0.10	<0.28

<u>COMMENTS:</u> Please see attached lab footnote report for any applicable footnotes.

Level of Quantitatio	on: 0.10 mg	Submitted by: KGB	Approved by: JGC
-	: mod. NIOSH 5042; Gravimetric	Date : 28-APR-23	
Collection Media	: PTFE PW lu 37mm	Supervisor : JGC	



LABORATORY FOOTNOTE REPORT

6601 Kirkville Road East Syracuse, NY 13057 (315) 432-5227 FAX: (315) 437-0571 www.sgsgalson.com

Site : POOLESVILLE HS Project No. : POOLESVILLE HS Date Sampled : 20-APR-23

Client Name : KCI Technologies

Date Received: 21-APR-23 Date Analyzed: 27-APR-23 Account No.: 17844 Login No. : L592039

L592039 (Report ID: 1355139):

SOPs: ic-asphalt(26) BSF = Benzene Soluble Fraction

L592039 (Report ID: 1355139):

Accuracy and mean recovery data presented below is based on a 95% confidence interval (k=2). The estimated accuracy applies to the media, technology, and SOP referenced in this report and does not account for the uncertainty associated with the sampling process. The accuracy is based solely on spike recovery data from internal quality control samples. Where N/A appears below, insufficient data is available to provide statistical accuracy and mean recovery values for the associated analyte.

Parameter	Accuracy	Mean Recovery
Asphalt Fumes (Benzene-Soluble Fractic	on) +/-15.7%	93%

Asphalt Fumes (Benzene-Soluble Fraction) +/-15.7%

771896812749 Date:04/21/23 Shipper:FEDEX Initials:AMF

Prep:UNKNOWN






T: To ound Time (TAT):	(surcharge) You may ec	lit and complete this COC ele	ctronica	ally by log	ging in to your	Client Portal accoun	nt at <u>https://po</u>	rtal.galsonlabs.co	om/		
Standard	0%										the Describility	
4 Business Days	35%	Client Acct									unts Payable	
3 Business Days	50%	17844	Company Name :					U	• •		TECHNOLOGIES INC Ridgebrook Road	· · · · · ·
2 Business Days	75%	Original Pre		936	Ridgebi	rock Road			Address 2 :	930	Ridgebiook Road	
Next Day by 6pm	100%	PSY69297	Audie33 2 .				152			Snar	ks, MD 21152	
Next Day by Noon	150%]	Phone No. :				152			<u> </u>	- 316 - 0818	
Same Day	200%	CS Rep:	Cell No. :	410	- 091 -				Email Address :			
	-1	TLANCAST		Jona	than Co			<u> </u>	Comments :			
Samples submitted usin FreePumpLoan™ Progra						oale@kci.cc			P.O. No. :			
Samples submitted usin	ng the	Online COC	: No.: Comments					<u>-</u>	Payment info. :		vill call SGS Galson to provide	e credit card info
FreeSamplingBadges™	Program	269636								Ca	rd on File (enter the last five (digits on the line below)
Comments :									State Sampled	d :	Please indicate which OEL(s)	this data will be used for
Comments .												
									mD] Other :
											Specify Limit(s)	Specify Other
Site Name : Poolesvil	le HS	Proj	ject: Poolesville HS			Sampled By :	Brittany	maas	List description	of indu	istry or Process/interferences	present in sampling area
Sample ID * (Maximum of 20 Charact		ate Sampled *	Collection Medium	n	Sa	nple Volume mple Time mple Area *	Liters Ú Minutes in², cm², ft² *	Ana	lysis Requested		Method Reference ^	Hexavalent Chromiun Process (e.g., welding plating, painting, etc
PH-01B	4	/20/23	37mm lum PW PTFE, (black band)	2pc		20 Liters - \$41:00	360 min.		Fume (Benzer Fraction)	ne	mod. NIOSH 5042; Gravimetric	
			37mm 1um PW PTFE,	2pc	36	O Liters	360 min	Asphalt	Fume (Benze	ne	mod. NIOSH 5042;	
PH-02B	4	1/20/23	(black band)		100.1	54 - 14:04	· · ·	Soluble	Fraction)		Gravimetric	
		· ·					1.0L/min					
^ If the method(s) indic	ated on the	COC are not o	ur routine/preferred method	s}, we v	vill substit	ute our routine.	/preferred methods.	If this is not a	cceptable, check	here to	have us contact you.	
Chain of Custody		Print Name /		<u> </u>	Date	Time		~ _	Print Name	/ Signa	ture	Date Time
Relinquished By : Brit	Hanv n	laas	Button Mar	4/2	20/23		Received By :	Wa Fer	reira	\mathcal{L}	- 14	2,13 1511
Relinquished By :	1						Received By :			pæ	Je	· (
						-	nples which you are dered as next day's				Online COC No. : 269 Prep No. : PS) Account No. : 178 Draft : 4/12	(692971
	All ser	vices are rend	lered in accordance with the	applicat	ole SGS G	eneral Conditio	ns of Service access	sible via: <u>http:/</u>	/www.sgs.com/e	n/Term	s-and-Conditions.aspx	
L											, , , , , , , , , , , , , , , , , , ,	
Page : 1 / 2			Page 5	of 6	SGS Nor	th 6601 Kirkvil Reference:	le Road E. Syracus 1 Generated:2	e, NY 13057, l 8-APR-23	JSA t +1 888 43 13:47	2 5227	+1 315 432 5227 www.galse	onlabs.com www.sgs.co

Inc.



Comments :



CHAIN OF CUSTODY

elinquished By :	0			-	Received By : nples which you are s dered as next day's b	submitting.	Online COC No. : 26963 Prep No. : PSY65 Account No. : 17844	92971-1
Relinquished By : Br	Hany maas	Button Maron	4/201	23	Received By :	Na Ferreira	5. 4/2	123 1511
hain of Custody	Print Name / S	Signature	Date	Time		Print Name / Signa	ature	Date Time
] ^ If the method(s) in	dicated on the COC are not of	I r routine/preferred method(s	s), we will su	bstitute our routine/	preferred methods. I	I f this is not acceptable, check here t	o have us contact you.	e
							· · · · · · · · · · · · · · · · · · ·	
PH - 08 B	4/20/23	37mm 1um PW PTFE, (black band)	2рс		_	Asphalt Fume (as Total Dust)	mod. NIOSH 5042/MDHS 14/4; GRAV	
PH-07B	4/20/23	(black band)	zpe			Dust)	mod. NIOSH 5042/MDHS 14/4; GRAV	
PH-06B	4/20/23	(black band) 37mm 1um PW PTFE,		18:22-14:22		Dust) Asphalt Fume (as Total	14/4; GRAV	
-		-	F	360 Liters	360 min	Asphalt Fume (as Total	mod. NICSH 5042/MDHS	
PH-05B	4/20/23	37mm lum PW PTFE, (black band)		360 Liters	360 min	Asphalt Fume (as Total Dust)	mod. NICSH 5042/MDHS 14/4; GRAV	
PH-04B	4/20/23	37mm 1um PW PTFE, (black band)		360 Liters	360 min	Asphalt Fume (as Total Dust)	mod. NIOSH 5042/MDHS 14/4; GRAV	
PH-03B	4/20/23	-	c	8:09-14:09		Asphalt Fume (as Total Dust)	mod. NIOSH 5042/MDHS 14/4; GRAV	
Sample ID * (Maximum of 20 Char		Collection Medium		Sample Volume Sample Time Sample Area * 360 Liters	Liters Minutes in², cm², ft² * 360 min	Analysis Requested	Method Reference *	Hexavalent Chrom Process (e.g., weld plating, painting, e

SGS North 6601 Kirkville Road E. Syracuse, NY 13057, USA t+1 888 432 5227 |+1 315 432 5227 www.galsonlabs.com | www.sgs.com Page 6 of 6 Report Reference:1 Generated:28-APR-23 13:47