

ENGINEERS • PLANNERS • SCIENTISTS • CONSTRUCTION MANAGERS

936 RIDGEBROOK ROAD • SPARKS, MD 21152 • 410-316-7800 • (FAX) 410-316-7935

May 11, 2023

Mr. Brian Croyle, Environmental Specialist Montgomery County Public Schools Division of Sustainability and Compliance 8301 Turkey Thicket Drive Gaithersburg, MD 20879

Ref: <u>Sampling for Asphalt Fumes and Hydrogen Sulfide Gas</u> Poolesville High School KCI Job No. 122302497

KCI Technologies Inc. (KCI) is submitting the following letter report detailing the findings of air sampling of Asphalt Fumes (benzene soluble fraction) and Hydrogen Sulfide gas at Poolesville High School located at 17501 W. Willard Rd. Poolesville, MD 20837 (subject site). Baseline sampling was conducted by KCI's Industrial Hygienist, Ms. Brittany Maas, under the oversight of KCI's Certified Industrial Hygienist (CIH), Mr. Jonathan Coale.

Background:

At Poolesville High School, current renovations and construction has raised concerns from student parents. Students and faculty have voiced concerns related to an odor present in the school while the roofing work is occurring. The parents are concerned the students are being exposed to unsafe conditions related to the asphalt fumes being produced during the roofing installation. MCPS contacted KCI to assist them in collecting data on the school's occupants' potential exposure to fumes related to the roofing work being conducted.

Description of the Work Performed:

On April 28, 2023, KCI conducted air sampling for Asphalt Fumes (benzene soluble fraction) and Hydrogen Sulfide gas levels at Poolesville High School. The sampling of Asphalt Fumes (benzene soluble fraction) was done under method: Modified NIOSH 5042. This method will determine the total concentration of total particulate and the soluble fraction to which an individual is exposed. NIOSH has an adopted value of 5 mg/m³ Threshold Limit Value (TLV) -Time-Weighted Average (TWA) for asphalt fumes. NIOSH's definition of TLV-TWA is the "concentration for a conventional 8-hour workday and a 40-hour workweek, to which it is believed that nearly all workers may be repeatedly exposed, day after day, for a working lifetime without adverse effect". KCI also utilized a mulit-gas meter to collect real time readings of hydrogen sulfide (H₂S), carbon monoxide (CO), and oxygen (O₂) levels in various locations throughout the building and exterior. Direct read data was performed to collect short term "grab" samples to determine if the gas was present and was not intended to collect exposure data.

During the time of the air sampling, construction was being conducted, there was no asphalt smell noted outside of the building. KCI placed six (6) sampling pumps set to approximately 1 liter per minute in locations pre-determined by MCPS. It is KCI's understanding that the sample locations selected by MCPS were where complaints were made from students. After all sampling pumps were placed, KCI took real time readings of the hydrogen sulfide levels at each of these locations every 30 minutes inside and

every 30 minutes outside. A sampling location map can be found in attachment A.

KCI conducted the screening from approximately 08:00 until 14:30. Conditions during the sampling period were heavy rain and $54^{\circ}F$ - $55^{\circ}F$. Winds were between 10 and 21mph with gusts up to 31mph from E and ENE.

After sampling, the cassettes were sealed, logged, bagged, and shipped as required to Galson Laboratories in East Syracuse, NY, where they were analyzed for Asphalt Fume (benzene soluble fraction) Modified NIOSH Method 5042. Galson Laboratories is accredited by the American Industrial Hygiene Association (#100324).

<u>Results:</u>

Table 1 – Asphalt Fumes Sampling Summary									
Location	Sample Number	Concentration (mg/m ³)	Above TLV-TWA?						
Arts Hallway – Outside Room 44	PHS - 01B	<0.28	No						
Auditorium Lobby	PHS - 02B	<0.28	No						
Gym Hallway	PHS - 03B	<0.28	No						
Science Building 1 st Floor – Outside Room 184	PHS-04B	<0.28	No						
Science Building 2 nd Floor – Outside Room 284	PHS-05B	<0.28	No						
Science Building 1 st Floor – Back Stairwell	PHS – 06B	<0.28	No						
Field Blank	PHS - 07B	N/A	N/A						
Lab Blank	PHS - 08B	N/A	N/A						
N/A: Not Applicable									

Asphalt Fumes (Benzene Soluble Fraction)

Laboratory analysis results are included as Attachment B.

Gas Meter Readings

	Table 2 – Multi-Gas Meter Sampling Summary									
Time	Oxygen (O ₂)	Carbon Monoxide (CO)	Hydrogen Sulfide (H ₂ S)							
0800 - 0820	20.8	0	0							
0830 - 0835	20.8	0	0							
0900 - 0905	20.8	0	0							
0930 - 0935	20.8	0	0							
1000 - 1005	20.8	0	0							
1030 - 1035	20.8	0	0							
1100 - 1105	20.8	0	0							
1130 - 1135	20.8	0	0							
1200 - 1205	20.8	0	0							
1230 - 1235	20.8	0	0							
1300 - 1305	20.8	0	0							
1330 - 1335	20.8	0	0							
1400 - 1420	20.8	0	0							

Olfactory Findings

During walkthroughs, KCI noted the following asphalt smells:

Table 3 – Olfactory Investigation Summary								
Location	Findings							
Exterior Outside New Main Office	No Asphalt Smell							
Exterior Between Main Building & Science/Tech Addition	No Asphalt Smell							
Exterior By Portables	No Asphalt Smell							
Main Lobby	No Asphalt Smell							
Art Hallway	No Asphalt Smell							
Auditorium Corridor	No Asphalt Smell							
Gym Hallway	No Asphalt Smell							
Science and Technology Addition	No Asphalt Smell							
Student Parking Lot	No Asphalt Smell							

Conclusion:

In conclusion, the baseline sampling data determined airborne Asphalt Fumes concentrations were below the NIOSH TLV-TWA adopted value during the period of sampling. In addition, H_2S and CO concentrations were not present or at concentrations below the gas meters detectable range. Oxygen levels were at the expected levels.

During sampling, no asphalt roofing activities were being performed.

If you have questions or comments regarding this report, please contact me.


Sincerely, KCI Technologies, Inc


Jonathan S. Coale, CIH, CIEC Certified Industrial Hygienist KCI Technologies, Inc.

Attachment A: Sample Locations Attachment B: Laboratory Certificate of Analysis Report for Air Samples

M:\2023\122302497\REPORTS\4.28.23 REPORT\LETTER REPORT-4.28.23 AIR SAMPLING_POOLESVILLE HS.DOC

Attachment A Field Notes

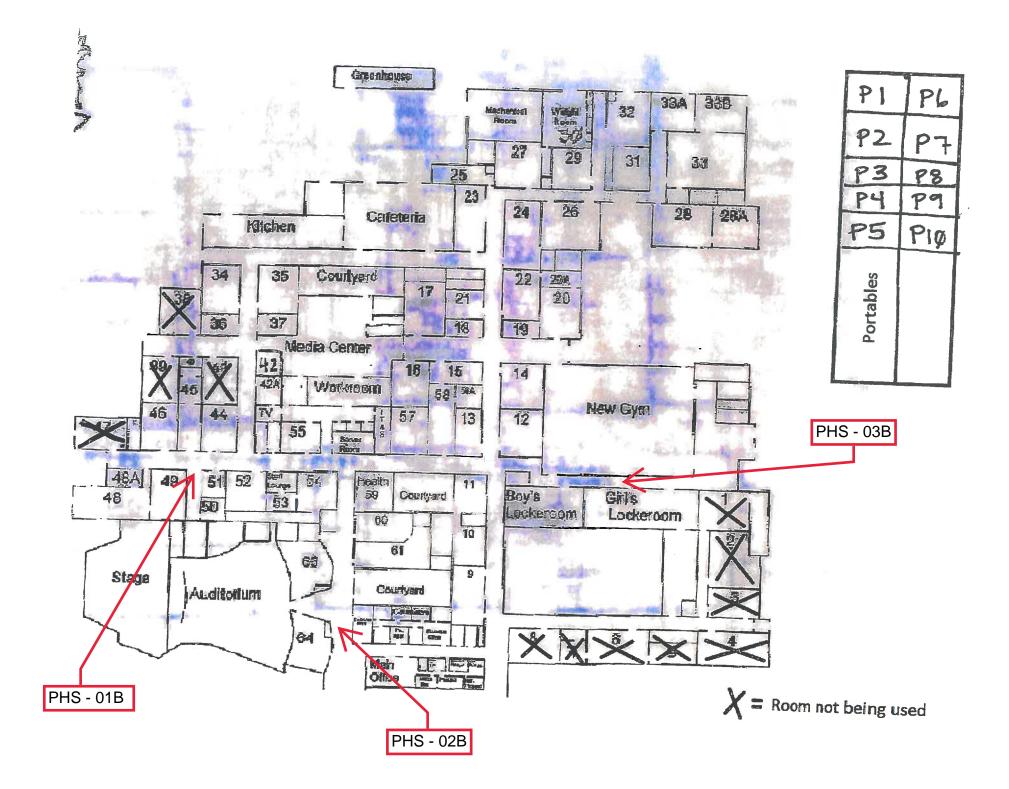

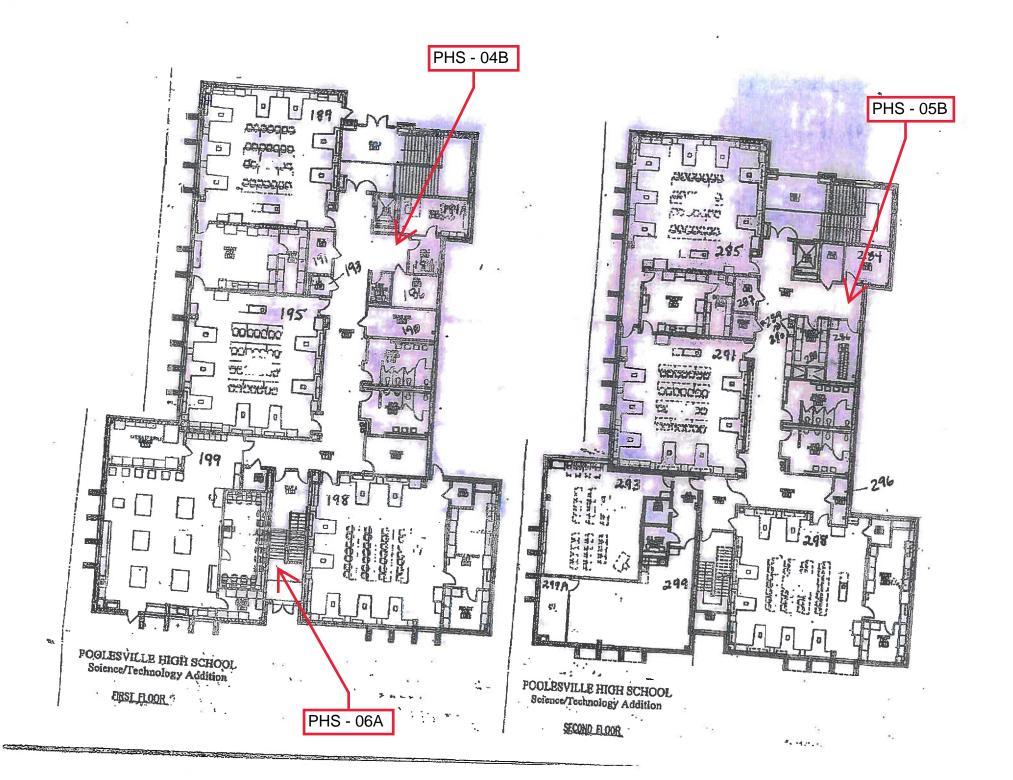

Attachment B Laboratory Certificate of Analysis Report for Air Samples



Jon Coale KCI Technologies 936 Ridgebrook Road Sparks Glencoe, MD 21152 May 04, 2023

Account# 17844

Login# L592809

Dear Jon Coale:

Enclosed are the analytical results for the samples received by our laboratory on May 01, 2023. All samples on the chain of custody were received in good condition unless otherwise noted. Any additional observations will be noted on the chain of custody.

Please contact client services at (888) 432-5227 if you would like any additional information regarding this report. Thank you for using SGS Galson.

Sincerely,

SGS Galson

Lisa-Luab

Lisa Swab Laboratory Director

Enclosure(s)



ANALYTICAL REPORT

Terms and Conditions & General Disclaimers

- This document is issued by the Company under its General Conditions of Service accessible at http://www.sgs.com/en/Terms-and-conditions.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein.
- Any holder of this document is advised that information contained herein reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law.

Analytical Disclaimers

- Unless otherwise noted within the report, all quality control results associated with the samples were within established control limits or did not impact reported results.
- Note: The findings recorded within this report were drawn from analysis of the sample(s) provided to the laboratory by the Client (or a third party acting at the Client's direction). The laboratory does not have control over the sampling process, including but not limited to the use of field equipment and collection media, as well as the sampling duration, collection volume or any other collection parameter used by the Client. The findings herein constitute no warranty of the sample's representativeness of any sampled environment, and strictly relate to the samples as they were presented to the laboratory. For recommended sampling collection parameters, please refer to the Sampling and Analysis Guide at www.sgsgalson.com.
- Unrounded results are carried through the calculations that yield the final result and the final result is rounded to the number of significant figures appropriate to the accuracy of the analytical method. Please note that results appearing in the columns preceding the final result column may have been rounded and therefore, if carried through the calculations, may not yield an identical final result to the one reported.
- The stated LOQs for each analyte represent the demonstrated LOQ concentrations prior to correction for desorption efficiency (if applicable).
- Unless otherwise noted within the report, results have not been blank corrected for any field blank or method blank data.

Accreditations SGS Galson holds a variety of accreditations and recognitions. Our quality management system conforms with the requirements of ISO/IEC 17025. Where applicable, samples may also be analyzed in accordance with the requirements of ELAP, NELAC, or LELAP under one of the state accrediting bodies listed below. Current Scopes of Accreditation can be viewed at http://www.sgsgalson.com in the accreditations section of the "About" page. To determine if the analyte tested falls under our scope of accreditation, please visit our website or call Client Services at (888) 432-5227.

National/International	Accreditation/Recognition	Lab ID#	Program/Sector
AIHA-LAP, LLC - IHLAP, ELLAP, EMLAP	ISO/IEC 17025 and USEPA NLLAP	Lab ID 100324	Industrial Hygiene, Environmental Lead,
		Environmental N	

State	Accreditation/Recognition	Lab ID#	Program/Sector
New York (NYSDOH)	ELAP and NELAC (TNI)	Lab ID: 11626	Air Analysis, Solid and Hazardous Waste
Louisiana (LDEQ)	LELAP	Lab ID: 04083	Air Analysis, Solid Chemical Materials

Legend

< - Less than > - Greater than	mg - Milligrams ug - Micrograms m2 - Cubia Matara	MDL - Method Detection Limit NA - Not Applicable	ppb - Parts per Billion ppm - Parts per Million
l - Liters	m3 - Cubic Meters	NS - Not Specified	ppbv - ppb Volume
LOQ - Limit of Quantitation	kg - Kilograms	ND - Not Detected	ppmv - ppm Volume
ft2 - Square Feet	cm2 - Square Centimeters	in2 - Square Inches	ng - Nanograms



LABORATORY ANALYSIS REPORT

6601 Kirkville Road East Syracuse, NY 13057 (315) 432-5227 FAX: (315) 437-0571 www.sgsgalson.com

Client	: KCI Technologies	Account No.: 17844
Site	: POOLESVILLE HIGH SCHOOL	Login No. : L592809
Project No.	: POOLESVILLE HS	
Date Sampled	: 28-APR-23	Date Analyzed : 04-MAY-23
Date Received	: 01-MAY-23	Report ID : 1356400

Asphalt Fumes (Benzene-Soluble Fraction)

Sample ID	Lab ID	Air Vol liter	Total mq	Conc mg/m3
PHS-01B	L592809-1	360	<0.10	<0.28
PHS-02B	L592809-2	360	<0.10	<0.28
PHS-03B	L592809-3	360	<0.10	<0.28
PHS-04B	L592809-4	360	<0.10	<0.28
PHS-05B	L592809-5	360	<0.10	<0.28
PHS-06B	L592809-6	360	<0.10	<0.28
PHS-07B	L592809-7	NA	<0.10	NA
PHS-08B	L592809-8	NA	<0.10	NA

COMMENTS: Please see attached lab footnote report for any applicable footnotes.

Level of Quantitation: 0.10 mg Submitted	by: PMH	Approved by: JGC
Analytical Method : mod. NIOSH 5042; Gravimetric Date Collection Media : PTFE PW 1u 37mm Supervisor	: 04-MAY-23	



LABORATORY FOOTNOTE REPORT

6601 Kirkville Road East Syracuse, NY 13057 (315) 432-5227 FAX: (315) 437-0571 www.sgsgalson.com

Client Name : KCI Technologies Site : POOLESVILLE HIGH SCHOOL Project No. : POOLESVILLE HS

Date Sampled : 28-APR-23 Date Received: 01-MAY-23 Date Analyzed: 04-MAY-23 Account No.: 17844 Login No. : L592809

L592809 (Report ID: 1356400):

SOPs: ic-asphalt(26) BSF = Benzene Soluble Fraction

L592809 (Report ID: 1356400):

Accuracy and mean recovery data presented below is based on a 95% confidence interval (k=2). The estimated accuracy applies to the media, technology, and SOP referenced in this report and does not account for the uncertainty associated with the sampling process. The accuracy is based solely on spike recovery data from internal quality control samples. Where N/A appears below, insufficient data is available to provide statistical accuracy and mean recovery values for the associated analyte.

93%

Parameter	Accuracy	Mean Recovery

Asphalt Fumes (Benzene-Soluble Fraction) +/-15.7%

GALSON

771980474740 Date:05/01/23 Shipper:FEDEX Initials:MMM

Prep:UNKNOWN

CHAIN OF CUSTODY

Turn Around Time (TAT):	(surcharge)	You may edit	and complete this COC ele	ctronically	ν by logging ir	n to your	Client Portal accour	nt at https://pc	rtal.gaisonlabs.co	 2m/				
X Standard	0%	<u> </u>				·		<u>_</u>					<u> </u>	
4 Business Days	35%	Client Acct No	o.: Report To :	Jon Co	bale				Invoice To :	Acco	ounts Payable			
3 Business Days	50%	17844	Company Name :	KCI Te	chnologie	6	<u></u>	c	ompany Name :	KCI TECHNOLOGIES INC				
2 Business Days	75%	1		936 Ri	dgebrook	Road			Address 1 :	936	Ridgebrook Road			
Next Day by 6pm	100%	Original Prep PSY694220	No.: Address 2 :				<u> </u>		Address 2 :	,				
Next Day by Noon	150%	City, State Zip: Sparks Glencoe, MD 21152						City, State Zip :	Spar	ks, MD 21152				
Same Day	200%	Phone No.: <u>410 - 891 - 1810</u>						Phone No. :	410	- 316 - 0818				
		TLANCASTE	Cell No. : R						Email Address :	ap@k	ci.com			
Samples submitted usin			Email reports to :				· · · · · · · · · · · · · · · · · · ·		Comments :					
FreePumpLoan™ Progra		Online COC N			an.Coale@	kci.co			P.O. No. :					
Samples submitted usin FreeSamplingBadges™		270339	Comments :						Payment info. :		rill call SGS Galson to pr	rovide c	redit card	info
										LICa	rd on File (enter the last	five dig	its on the	line below)
									·					
Comments: 54°F;	9190	RH; St	eady Rain						State Sampled	: 1	Please indicate which O	EL(s) th	s data wi	ll be used for :
				· ·						E	🗆 OSHA PEL 🛛 ACGI	h tlv	⊐мsна	
. NO KO	onna	work	being done -	1000	М				WD	Ì	🗆 IAQ :	□c	ther:	
											Specify Limit(s)	_	·	cify Other
Site Name : Poolesvil	le Hio		t: Poolesville HS		Sample	ed By : 1	Brittany N Liters	1005	List description of	of indu	stry or Process/interfere	nces pre	esent in sa	ampling area :
	<u>re na</u>	1 201001			Sample Vo	turne L	Liters				J			
Sample ID * (Maximum of 20 Charact	ers) Dat	te Sampled *	Collection Medium	n	Sample Ti	ime	Minutes	1	ysis Requested		Method Reference	^		ent Chromium (e.g., welding,
				-	Sample Ar		in², cm², ft² *							painting, etc.)
PHS-OIB	4	28123	37mm 1um PW PTFE, (black band)	-	360 1		360 min	Asphalt Soluble	Fume (Benzen)	e	mod. NIOSH 5042;			
			37mm 1um PW PTFE,		<u> 8:03 - 14</u>						Gravimetric		_	
DUC ADP		128/23	(black band)	2pc	360 L		360 min	Soluble 1	Fume (Benzend Fraction)	e	mod. NIOSH 5042; Gravimetric			
PHS-02B		128145			8:07-14	1:07	JON WIN		,			ľ		
A If the method(s) indicates	ated on the C	OC are not our	routine/preferred method(s	s), we will s	substitute our	routine/	preferred methods. I	f this is not ac	ceptable, check h	ere to	have us contact you.			
Chain of Custody		Print Name / Sig		Dat		îme			Print Name / S			5	ate	Time
Relinquished By : R. 1	tany n	1005 T	Butta, Man	4/28	122 14:	45	Received By : W	Negon M	MGal		- with miller		1	11:02 h
Relinquished By :	iany			1/20			Received By :		110004	11	m Gr		173	11.02 1
		L	* You must	fill in these	e columns for	204 63	ples which you are s				Online COC No. :	270220		
							dered as next day's b	_			Prep No. :			
			Semplea	Tecerveo a	nei april wiit t	Je Lonan	bered as next day s d	Jusiness.			Account No. : Draft		23 7:28:57	
	All serv	ices are render	ed in accordance with the a	pplicable S	GGS General C	Condition	ns of Service accessil	ble via: <u>http://</u>	www.sqs.com/en/	Terms				
Page : 1 / 2				SG	S North 660	1 Kirkvill	e Road E. Syracuse,	, NY 13057, U	SA t+1 888 432 5	5227 -	+1 315 432 5227 www.g	alsonia	bs.com (v	www.sgs.com

America,

Page 5 of 6 Report Reference:1 Generated:04-MAY-23 15:49



GALSON CHAIN OF CUSTODY

Comments :												
			- 1	i	Sample Volu		Liters	_		T		
Sample (Maximum of 20		Date Sampled '	Collection Mediur	m	Sample Volu Sample Tin Sample Area	ne	Minutes in², cm², ft² *	An	alysis Requested	Method Reference ^	Hexavalent Chr Process (e.g., w plating, paintin	welding,
PHS-03	В	4/28/23	37mm lum PW PTFE, (black band)	-	360 L <u>8:10 - 14</u> :	10	360 mi	Asphalt N Soluble	Fume (Benzene Fraction)	mod. NIOSH 5042; Gravimetric		
PHS-09	В	4/28/23	37mm lum PW PTFE, (black band)	-	360 L 8:15-14		340 min	Asphalt	Fume (Benzene Fraction)	mod. NIOSH 5042; Gravimetric		
PHS- 05	»В	4/28/23	37mm lum PW PTFE, (black band)	2рс	360 L 8:19 - 14:		3Leonin	_	Fume (Benzene Fraction)	mod. NIOSH 5042; Gravimetric		
PHS - OF	в	4/28/23	37mm lum PW PTFE, (black band)	_	360 L 8:25 - 14		360 mir	-	Fume (Benzene Fraction)	mod. NIOSH 5042; Gravimetric		
PHS-0-	B	4/28/2	37mm lum PW PTFE, (black band)	2рс	<u> </u>			-	Fume (Benzene Fraction)	mod. NIOSH 5042; Gravimetric		
PHS-C	8B	4/28/23	37mm lum PW PTFE, (black band)	2рс	<i>~~~~</i>	-	<u> </u>	-	Fume (Benzene Fraction)	mod. NIOSH 5042; Gravimetric		
			-									
					_	+						
			•					_				
A If the method	s) indicated on t	he COC are not o	ur routine/preferred method(s), we will s	ubstitute our re	outine/pr	eferred methods.	If this is not	acceptable, check here to	have us contact you.		
Chain of Custody		Print Name / :	Signature	Date	e Tim	ne			Print Name / Signa	Are 1 1 1	Date, Ti	ime
Relinquished By :	Brittany N	laas	Batton m	4/28	123 14:4	15	Received By :	Nega Y	MMCGrath W	egun M/ M/Gale	5/1/23 11:	09A
Relinguished By :							Received By :	10		7 / /		
	* You must fill in these columns for any samples which you are submitting. Samples received after 3pm will be considered as next day's business. Draft : 4/21/2023 7:28:57 AM											
	All	services are rend	ered in accordance with the a	applicable S	GS General Co	onditions	of Service access	ible via: <u>http</u>	//www.sgs.com/en/Term	s-and-Conditions.aspx		

SGS North 6601 Kirkville Road E. Syracuse, NY 13057, USA t+1 888 432 5227 +1 315 432 5227 www.galsonlabs.com | www.sgs.com